

QA-43
Slaughterton
Sudlersville vicinity
Private

c. 1820
c. 1850, 1900

Slaughterton is one of the better early 19th century farm houses in northern Queen Anne's County. Besides being constructed of brick, it has a fully developed floor plan of two rooms with central stair hall and a two room kitchen wing. It also possesses a mid-19th century wing referred to as the "school room" in a family diary. Although the windows and their respective trim have been changed, it possesses good period doors, door trim and mantels. In plan it is akin to its neighbor, Haddon Hall, but unlike it, Slaughterton's original plan was constructed in one period.

INVENTORY FORM FOR STATE HISTORIC SITES SURVEY

1 NAME

HISTORIC

"Slaughterton"

AND/OR COMMON

"The George Farm"**2 LOCATION**

STREET & NUMBER

Md. Rt. 300, 1 mile west of Sudlersville

CITY, TOWN

Sudlersville

VICINITY OF

CONGRESSIONAL DISTRICT

First

STATE

Maryland

COUNTY

Queen Anne's**3 CLASSIFICATION****CATEGORY**

☐ DISTRICT
☒ BUILDING(S)
☐ STRUCTURE
☐ SITE
☐ OBJECT

OWNERSHIP

☐ PUBLIC
☒ PRIVATE

☐ BOTH**PUBLIC ACQUISITION**

☐ IN PROCESS
☐ BEING CONSIDERED

STATUS

☒ OCCUPIED
☐ UNOCCUPIED
☐ WORK IN PROGRESS
ACCESSIBLE
☐ YES: RESTRICTED
☐ YES: UNRESTRICTED
☒ NO

PRESENT USE

☐ AGRICULTURE ☐ MUSEUM
☐ COMMERCIAL ☐ PARK
☐ EDUCATIONAL ☒ PRIVATE RESIDENCE
☐ ENTERTAINMENT ☐ RELIGIOUS
☐ GOVERNMENT ☐ SCIENTIFIC
☐ INDUSTRIAL ☐ TRANSPORTATION
☐ MILITARY ☐ OTHER

4 OWNER OF PROPERTY

NAME

Mr. & Mrs. John E. George

Telephone #:

STREET & NUMBER

CITY, TOWN

Sudlersville

VICINITY OF

STATE, zip code

Maryland 21668**5 LOCATION OF LEGAL DESCRIPTION**

COURTHOUSE,

REGISTRY OF DEEDS, ETC.

Queen Anne's County Courthouse

Liber #: TSP 70

Folio #: 413

STREET & NUMBER

Courthouse Square

CITY, TOWN

Centreville

STATE

Maryland**6 REPRESENTATION IN EXISTING SURVEYS**

TITLE

DATE

☐ FEDERAL ☐ STATE ☐ COUNTY ☐ LOCALDEPOSITORY FOR
SURVEY RECORDS

CITY, TOWN

STATE

7 DESCRIPTION

CONDITION		CHECK ONE	CHECK ONE
<input type="checkbox"/> EXCELLENT	<input type="checkbox"/> DETERIORATED	<input checked="" type="checkbox"/> UNALTERED	<input checked="" type="checkbox"/> ORIGINAL SITE
<input type="checkbox"/> GOOD	<input type="checkbox"/> RUINS	<input type="checkbox"/> ALTERED	<input type="checkbox"/> MOVED
<input checked="" type="checkbox"/> FAIR	<input type="checkbox"/> UNEXPOSED		DATE _____

DESCRIBE THE PRESENT AND ORIGINAL (IF KNOWN) PHYSICAL APPEARANCE

Slaughterton is located in the First Election District one mile west of Sudlersville on the north side of Maryland Route 300. The house is a two part, two story brick house of the early 19th century.

The main section of the house is five bays long, two stories and attic tall and one room deep. The south entrance occupies the central bay and retains its original six raised panel door with transom. The frames and sash of this section of the house were replaced around the turn of the century, probably when the porch was installed across three of the five bays. (Proportions of the windows suggest 9/6 sash for the first story and 6/6 sash for the second--the present ones are 2/2 on both stories). Jack arches over the openings are composed of alternating 2 headers and stretcher. There is no water table, but the cornice is composed of five courses of corbeled brick, the middle one set on an angle to create a dentil effect. The 'A' roof is covered with tin. The basement windows have five iron bars set into the masonry. The south facade of this portion of the house is the only part laid in Flemish bond; the remainder of the building, including

CONTINUE ON SEPARATE SHEET IF NECESSARY

CONTINUATION SHEET

7.1 DESCRIPTION

the kitchen wing, is laid in common bond (5-1).

East of the aforementioned section is a lower 2 1/2 story brick kitchen wing, two bays long and one deep. On the first story there are two doors and one window on the easternmost bay. Two windows on the second story are placed respectively over the west door and centered between the east door and window. Two dormer windows in the gambrel roof are above the second story windows. All windows of this facade have 6/6 sash. Arches above these windows are a simple row-lock course. A brick chimney pierces the roof within the east gable; a large chimney servicing both wings is located between the two.

The west gable of the house has a large chimney protruding about 8" from the wall, similar to the Leager Farm northeast of Sudlersville. There are only two small windows in the attic.

On the north side of the house a two story frame wing was added across two-thirds of the main part. A leanto porch was built across the north side of the kitchen wing, part of which is enclosed. The frame section was probably built around 1850 for the room is called a School Room in a family diary of that period.

The gambrel roof of the kitchen wing was probably added around 1900. It replaces an "A" roof. Behind the kitchen is an old brick smokehouse.

CONTINUATION SHEET

7.2 DESCRIPTION

The floor plan consists of two rooms with central stair hall in the larger part and two rooms, several steps lower, in the kitchen wing. Beginning from the west, the parlor has a fireplace protruding into the room. It has no chair rail or cornice and the window trim has been replaced. The stair is an open string stair with two rectangular balusters per step. The living room also has a fireplace projecting into the room. On the right side is the door to the kitchen wing; on the left side are five steps up to the 2nd story of the kitchen. On the north wall is one door to the "School Room".

The school room is a plain plastered room, now partly used for a bath.

Both rooms in the kitchen wing, the dining room and kitchen, are paneled with sheet paneling. In the northeast corner of the kitchen is a winder stair to the room above.

PERIOD	AREAS OF SIGNIFICANCE -- CHECK AND JUSTIFY BELOW			
REHISTORIC	<input type="checkbox"/> ARCHEOLOGY-PREHISTORIC	<input type="checkbox"/> COMMUNITY PLANNING	<input type="checkbox"/> LANDSCAPE ARCHITECTURE	<input type="checkbox"/> RELIGION
<input type="checkbox"/> 1400-1499	<input type="checkbox"/> ARCHEOLOGY-HISTORIC	<input type="checkbox"/> CONSERVATION	<input type="checkbox"/> LAW	<input type="checkbox"/> SCIENCE
<input type="checkbox"/> 1500-1599	<input type="checkbox"/> AGRICULTURE	<input type="checkbox"/> ECONOMICS	<input type="checkbox"/> LITERATURE	<input type="checkbox"/> SCULPTURE
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> ARCHITECTURE	<input type="checkbox"/> EDUCATION	<input type="checkbox"/> MILITARY	<input type="checkbox"/> SOCIAL/HUMANITARIAN
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> ART	<input type="checkbox"/> ENGINEERING	<input type="checkbox"/> MUSIC	<input type="checkbox"/> THEATER
<input checked="" type="checkbox"/> 1800-1899	<input type="checkbox"/> COMMERCE	<input type="checkbox"/> EXPLORATION/SETTLEMENT	<input type="checkbox"/> PHILOSOPHY	<input type="checkbox"/> TRANSPORTATION
<input type="checkbox"/> 1900-	<input type="checkbox"/> COMMUNICATIONS	<input type="checkbox"/> INDUSTRY	<input type="checkbox"/> POLITICS/GOVERNMENT	<input type="checkbox"/> OTHER (SPECIFY)
		<input type="checkbox"/> INVENTION		

SPECIFIC DATES

BUILDER/ARCHITECT

STATEMENT OF SIGNIFICANCE

Slaughterton is one of the better early 19th century farm houses in northern Queen Anne's County. Besides being constructed of brick, it has a fully developed floor plan of two rooms with central stair hall and a two room kitchen wing. It also possesses a mid-19th century wing referred to as the "school room" in a family diary. Although the windows and their respective trim have been changed, it possesses good period doors, door trim and mantels. In plan it is akin to its neighbor, Haddon Hall, but unlike it, Slaughterton's original plan was constructed in one period.

CONTINUE ON SEPARATE SHEET IF NECESSARY

9 MAJOR BIBLIOGRAPHICAL REFERENCES

Forman, H. Chandlee, Early Manor and Plantation Houses of
Maryland, Easton, 1934, p. 200.

CONTINUE ON SEPARATE SHEET IF NECESSARY

10 GEOGRAPHICAL DATA

ACREAGE OF NOMINATED PROPERTY _____

VERBAL BOUNDARY DESCRIPTION

LIST ALL STATES AND COUNTIES FOR PROPERTIES OVERLAPPING STATE OR COUNTY BOUNDARIES

STATE

COUNTY

STATE

COUNTY

11 FORM PREPARED BY

NAME / TITLE

Michael Bourne, Historic Sites Surveyor

ORGANIZATION

Queen Anne's County Historical Society

DATE

4/6/83

STREET & NUMBER

TELEPHONE

CITY OR TOWN

Centreville


STATE

Maryland

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature, to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 Supplement.


The Survey and Inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

RETURN TO: Maryland Historical Trust
 The Shaw House, 21 State Circle
 Annapolis, Maryland 21401
 (301) 267-1438

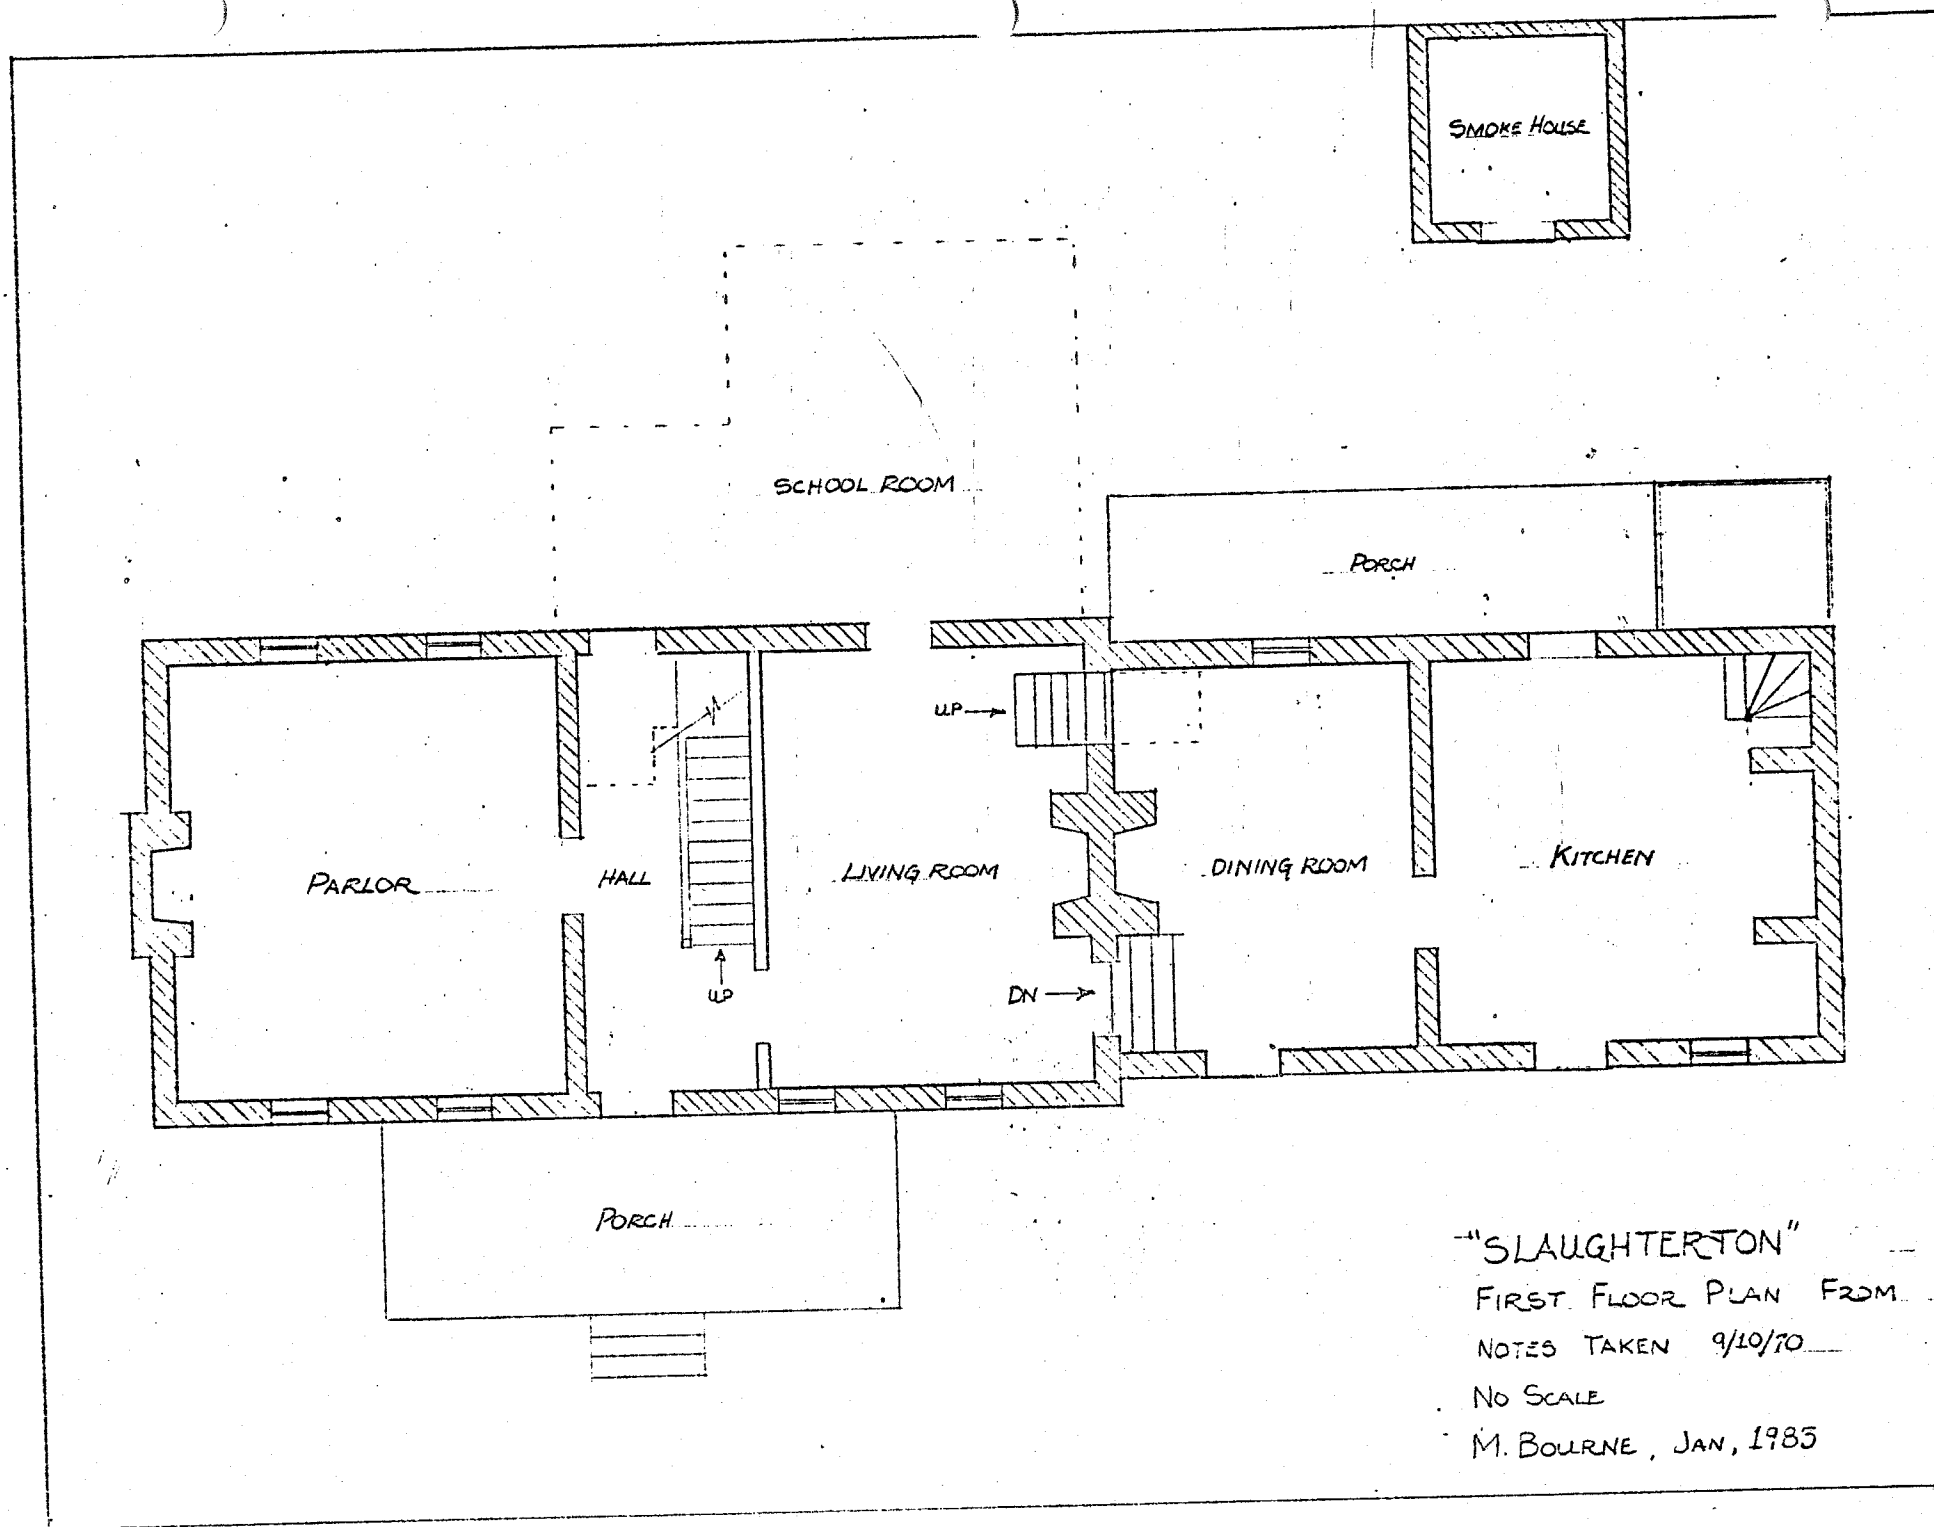

"SLAUGHTERTON"
FIRST FLOOR PLAN FROM
NOTES TAKEN 9/10/70
NO SCALE
M. BOURNE, JAN, 1985

QA-43

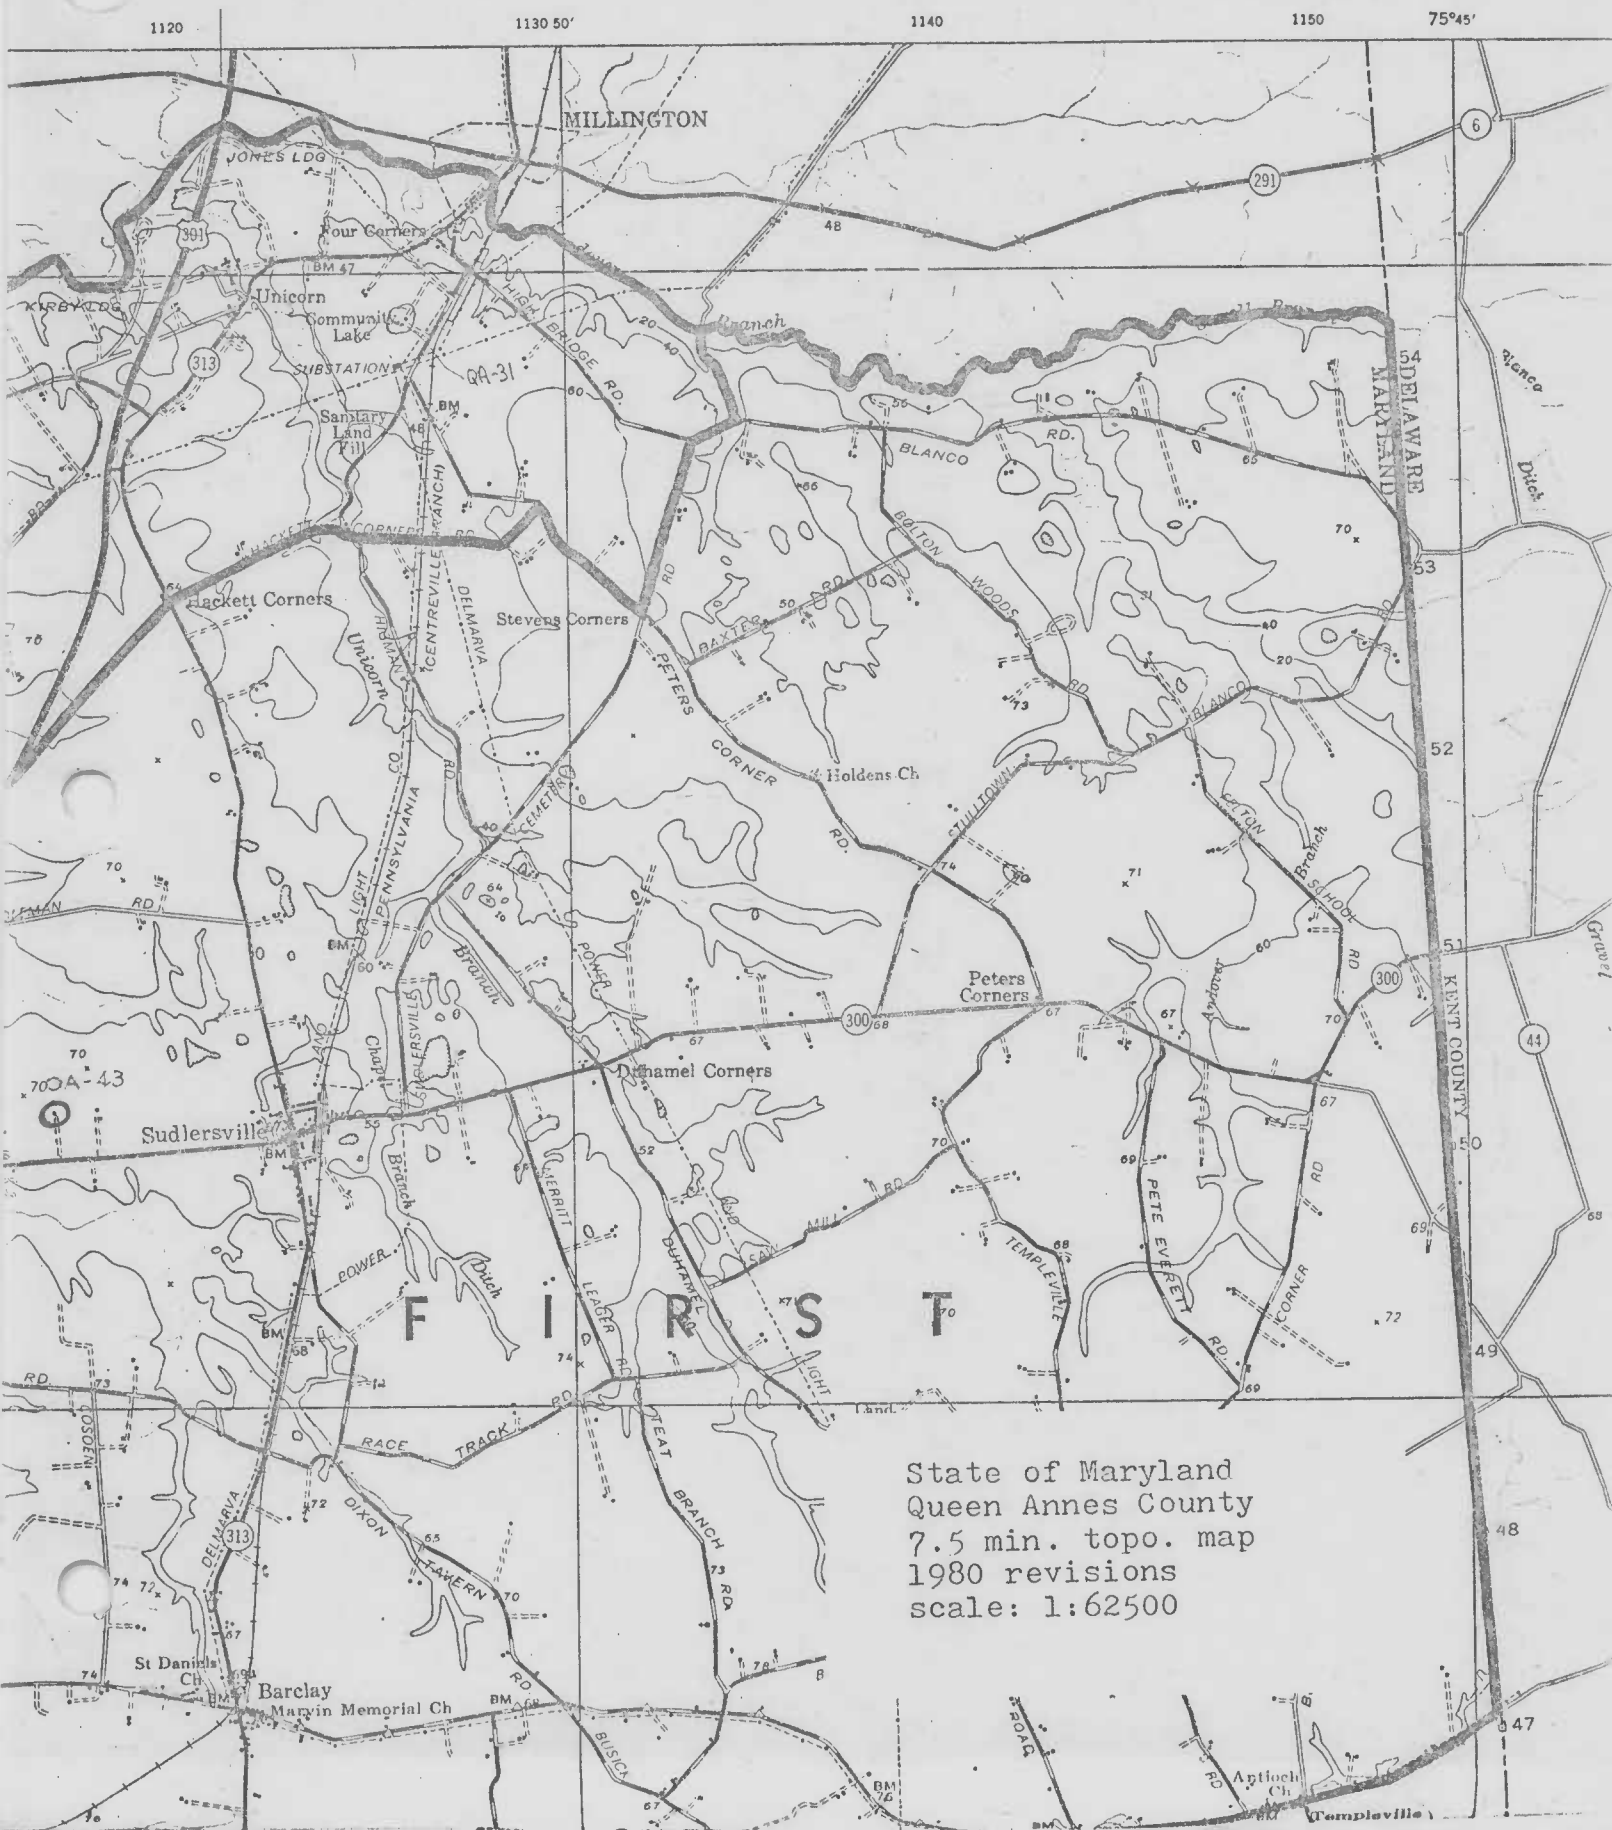

State of Maryland
Queen Annes County
7.5 min. topo. map
1980 revisions
scale: 1:62500

GA-48
Slaughterton

Mary McCarthy
Spring/Summer 2003
Digital color photo on file at MHT





QA-43

Slaughterton
Sudlersville vicinity
James W. Valliant, April 1974
South facade